Practical 2P11 - Transmission Electron Microscopy

Senior Demonstrators: Dr Ian Griffiths and Dr Neil Young

What you should learn from this practical

This practical ties-in with the lecture course on Microstructural Characterisation of Materials. Its

aim is:

1. to help you to understand how transmission electron microscopes (TEMs) operate;

2. to show you how to form electron diffraction patterns and diffraction contrast images;

3. to enable you to "see" directly features such as dislocations and precipitates;

4. to give you an idea of how such features can be characterised in more detail;

5. to introduce you to the technique of energy-dispersive X-ray (EDX).

Practical skills

The JEOL-2100L (200kV) transmission electron microscope will be operated by a demonstrator,

but you will expected to be familiar with the operating principles of transmission microscopes

(covered in the lectures). You will be shown basic TEM, how to set up various conditions and

imaging modes, recording both images and diffraction patterns, and how to use EDX to

analyse parts of the microstructure.

Overview of practical

1. You will examine a thin foil of Inconel-600 alloy, and observe and record images of

dislocations, grain-boundaries and any other features of interest under well-defined

diffraction conditions.

2. You will make some qualitative chemical analyses of precipitates using energy-dispersive X-

ray microanalysis and use this and other information to try to identify them.

Experimental details

1. Transmission Electron Microscopy of Inconel

Key measurements

- Estimate the grain size of the specimen
- Tilt to a zone axis, record both Kikuchi line patterns and some typical diffraction spot
 patterns. Diffraction patterns should be indexed and the zone axis should be deduced from
 the reflections present (only major zone-axes will be captured)
- Set up 2-beam diffraction conditions with one Bragg reflection strongly excited and observe and record in both bright- and dark-field the following:
 - o Thickness fringes, bend contours and areas which exhibit both 'mixed-up'. Use the thickness fringes to estimate the sample thickness in this region.
 - o Dislocations and dislocation networks,
 - o Grain boundaries and grain boundary contrast fringes.
 - o Precipitates.
 - o Any other features of interest.

For each of these discuss the impact of the microstructure upon the material properties and how these are of importance for the applications of Inconel-600.

For each of the above, pay attention to the effect only small tilts have on the image contrast. If time permits, explore how the image contrast of dislocations varies when different Bragg reflections are excited. If you can find a reflection where a particular dislocation is not visible, then the **g.b**=0 invisibility criterion can be used to deduce (or pin down) the possible Burgers vectors of the dislocations. The theory of this is covered in the Advanced Microstructural Characterisation course).

2. X-ray microanalysis

Key measurements

Use the EDX system to investigate the chemistry at various regions of the material:

- Observe the general appearance of the EDX spectrum in thin and thick parts of the foil
- Measure the bulk composition, and the local composition of precipitates and grain boundaries
- Identify which types of precipitate are present and make comments on the shape of them.

Link the above microstructural and chemical observations to the material properties of Inconel-600.

Safety considerations

The electron microscope operates at high voltage but is quite safe provided that you follow the normal operating procedures as advised by the demonstrators.

Under normal circumstances, the microscope room is limited to 5 students max plus demonstrators to prevent over-crowding.

Supporting Video contents

- Introduction (+bonus video of the sample being loaded into the holder)
- Experiment part 1: Focus on diffraction contrast
 - Measuring grain size
 - o Selected area diffraction patterns on zone axes
 - o Twins
 - o Thickness fringes and Bend contours
 - o Dislocations
 - o Precipitates
- Experiment part 2: Focus on EDX
 - o EDX spectra from thin and thick regions
 - o EDX spectra from intra-granular (within the grain) precipitates
 - o EDX spectra from inter-granular (between grains) precipitates

- o EDX spectra from grain boundaries
- Outro

What should be in the write-up

Style

- Log-book
- Structure and length should be as for other practicals.

Questions you should try to answer

You should concentrate on describing and interpreting the results obtained, including as much quantitative data as possible. Address the following questions:

- What is the general microstructures of the specimen? Include estimates of grain sizes and dislocation densities. Identify as many microstructural or imaging features as you can (e.g. grain boundary fringes, thickness fringes, bend contours) and describe how their contrast changes with diffraction conditions. Comment on any textures revealed by diffraction patterns.
- What types of precipitate are present? Where are they situated: within grains, along dislocations, at grain boundaries? What are their sizes, shapes and habit planes? Can you make a guess at their type from the EDX composition information? What diffraction pattern features do they produce (streaks, extra spots?), and why?

Not wanted in the report


You should be able to show knowledge and understanding of the design, operation and characteristics of the electron microscope, the required specimen preparation procedures, and the various mechanisms whereby image contrast arises. However you should **not** devote a major part of your write-up to any of this.

Appendix

Table 1: Extinction distance table for FCC Nickel, a=3.499 Å

| h | k | I | d (Å) | 1/d (Å ⁻¹) | Bragg angle (mrad) | Extinction distance ξ (nm) |
|---|---|----|-------|------------------------|--------------------|----------------------------|
| 1 | 1 | -1 | 2.02 | 0.50 | 6.21 | 66.17 |
| 2 | 0 | 0 | 1.75 | 0.57 | 7.17 | 73.15 |
| 2 | 2 | 0 | 1.24 | 0.81 | 10.14 | 103.78 |
| 1 | 1 | 3 | 1.05 | 0.95 | 11.89 | 121.20 |

Figure 1: Wave-function of electrons in a crystal in the two-beam approximation

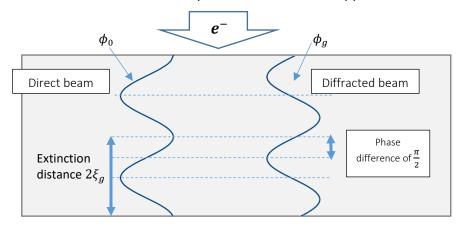


Howie-Whelan Equations

$$\frac{d\phi_0(r)}{dz} = \frac{\pi i}{\xi_a} \phi_g(r) e^{i g \cdot R(r)} \qquad \qquad \frac{d\phi_g(r)}{dz} = \frac{\pi i}{\xi_a} \phi_0(r) e^{i g \cdot R(r)} - 2\pi i s_g \phi_g(r)$$

You do not need to know these equations, but it is useful to appreciate that their solutions for the perfect two-beam condition $(s_g=0)$ and in a distortion-free crystal $(g\cdot R(r)=0)$ reveal a sinusoidal oscillation of the electron wavefunction as it propagates through the crystal, oscillating between the direct beam and reflection ${\bf g}$. We should see that in this condition, the images we set up from the direct beam (bright field) and from the strongly diffracted beam (dark field) will be reciprocal to each other, since ϕ_0 and ϕ_g are out of phase by $\frac{\pi}{2}$, and the intensity of the electron beam $I=|\phi|^2$.

Figure 2: Origin of thickness fringes

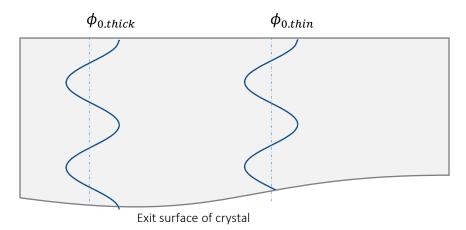

Consider ϕ_0 at two points in the crystal which have different thicknesses. The intensity of the electrons that make up our image depends on the wavefunction at the exit surface of the foil. Therefore, in two different positions of the crystal, one thick and one thin, the wavefunction at the exit surface will be at a different phase. The intensity of the electron beam is $|\phi_0|^2$ so cutting off the wavefunction at a maxima or minima will result in brighter intensity than a region that cuts the wavefunction when it crosses zero. This is what gives rise to thickness fringes, which have a periodicity equal to the extinction distance for that reflection ξ_g when s_g = 0 (perfect Bragg condition).

Figure 3: What's what on the microscope

